

797-2015_Escalator_No_06_Email_Recomendations
_Gulay_Elevator_Service_Inc._R00

Ruchkall, David

From: [REDACTED] ← Gulay Elevator Services Inc.
[REDACTED]
To: Ruchkall, David
Subject: RE: Winnipeg Concourse - Richardson Building Down Escalator No 6 - Work Order 1500028023 was submitted

Importance: High

Follow Up Flag: Follow up
Flag Status: Flagged

Categories: Important, Me, ELEVATORS



August 21, 2015

On Friday I attended to the escalator. [REDACTED] There is an intermittent grinding noise coming from the step chain drive area. That is located about two meters from the upper transition on the right side of the escalator (looking down). It is not coming from the brake, controller, anti reversal switch, or any individual step [REDACTED]. The step drive chain is [REDACTED] slightly dragging in its' track. It has stretched over the years and when that escalator is run in the down direction the chain bottom goes slack and it drags in the track.



My recommendation is to [REDACTED] open up the escalator, remove the necessary number of steps, and replace both step chains. At that time the noise coming from that area can be identified and resolved. I think it is probably a bearing going bad in a step chain guide bearing.



[REDACTED] ← Gulay Elevator Services Inc.