



**1** EXISTING TYPICAL GLULAM SECTION  
 S2.1 S4.1 3/4" = 1'-0"

\*ALL STEEL RECEIVING AIR BARRIER TO BE REMOVED OF PAINT TO WHITE METAL PRIOR TO APPLICATION (REFER TO SPECIFICATIONS)

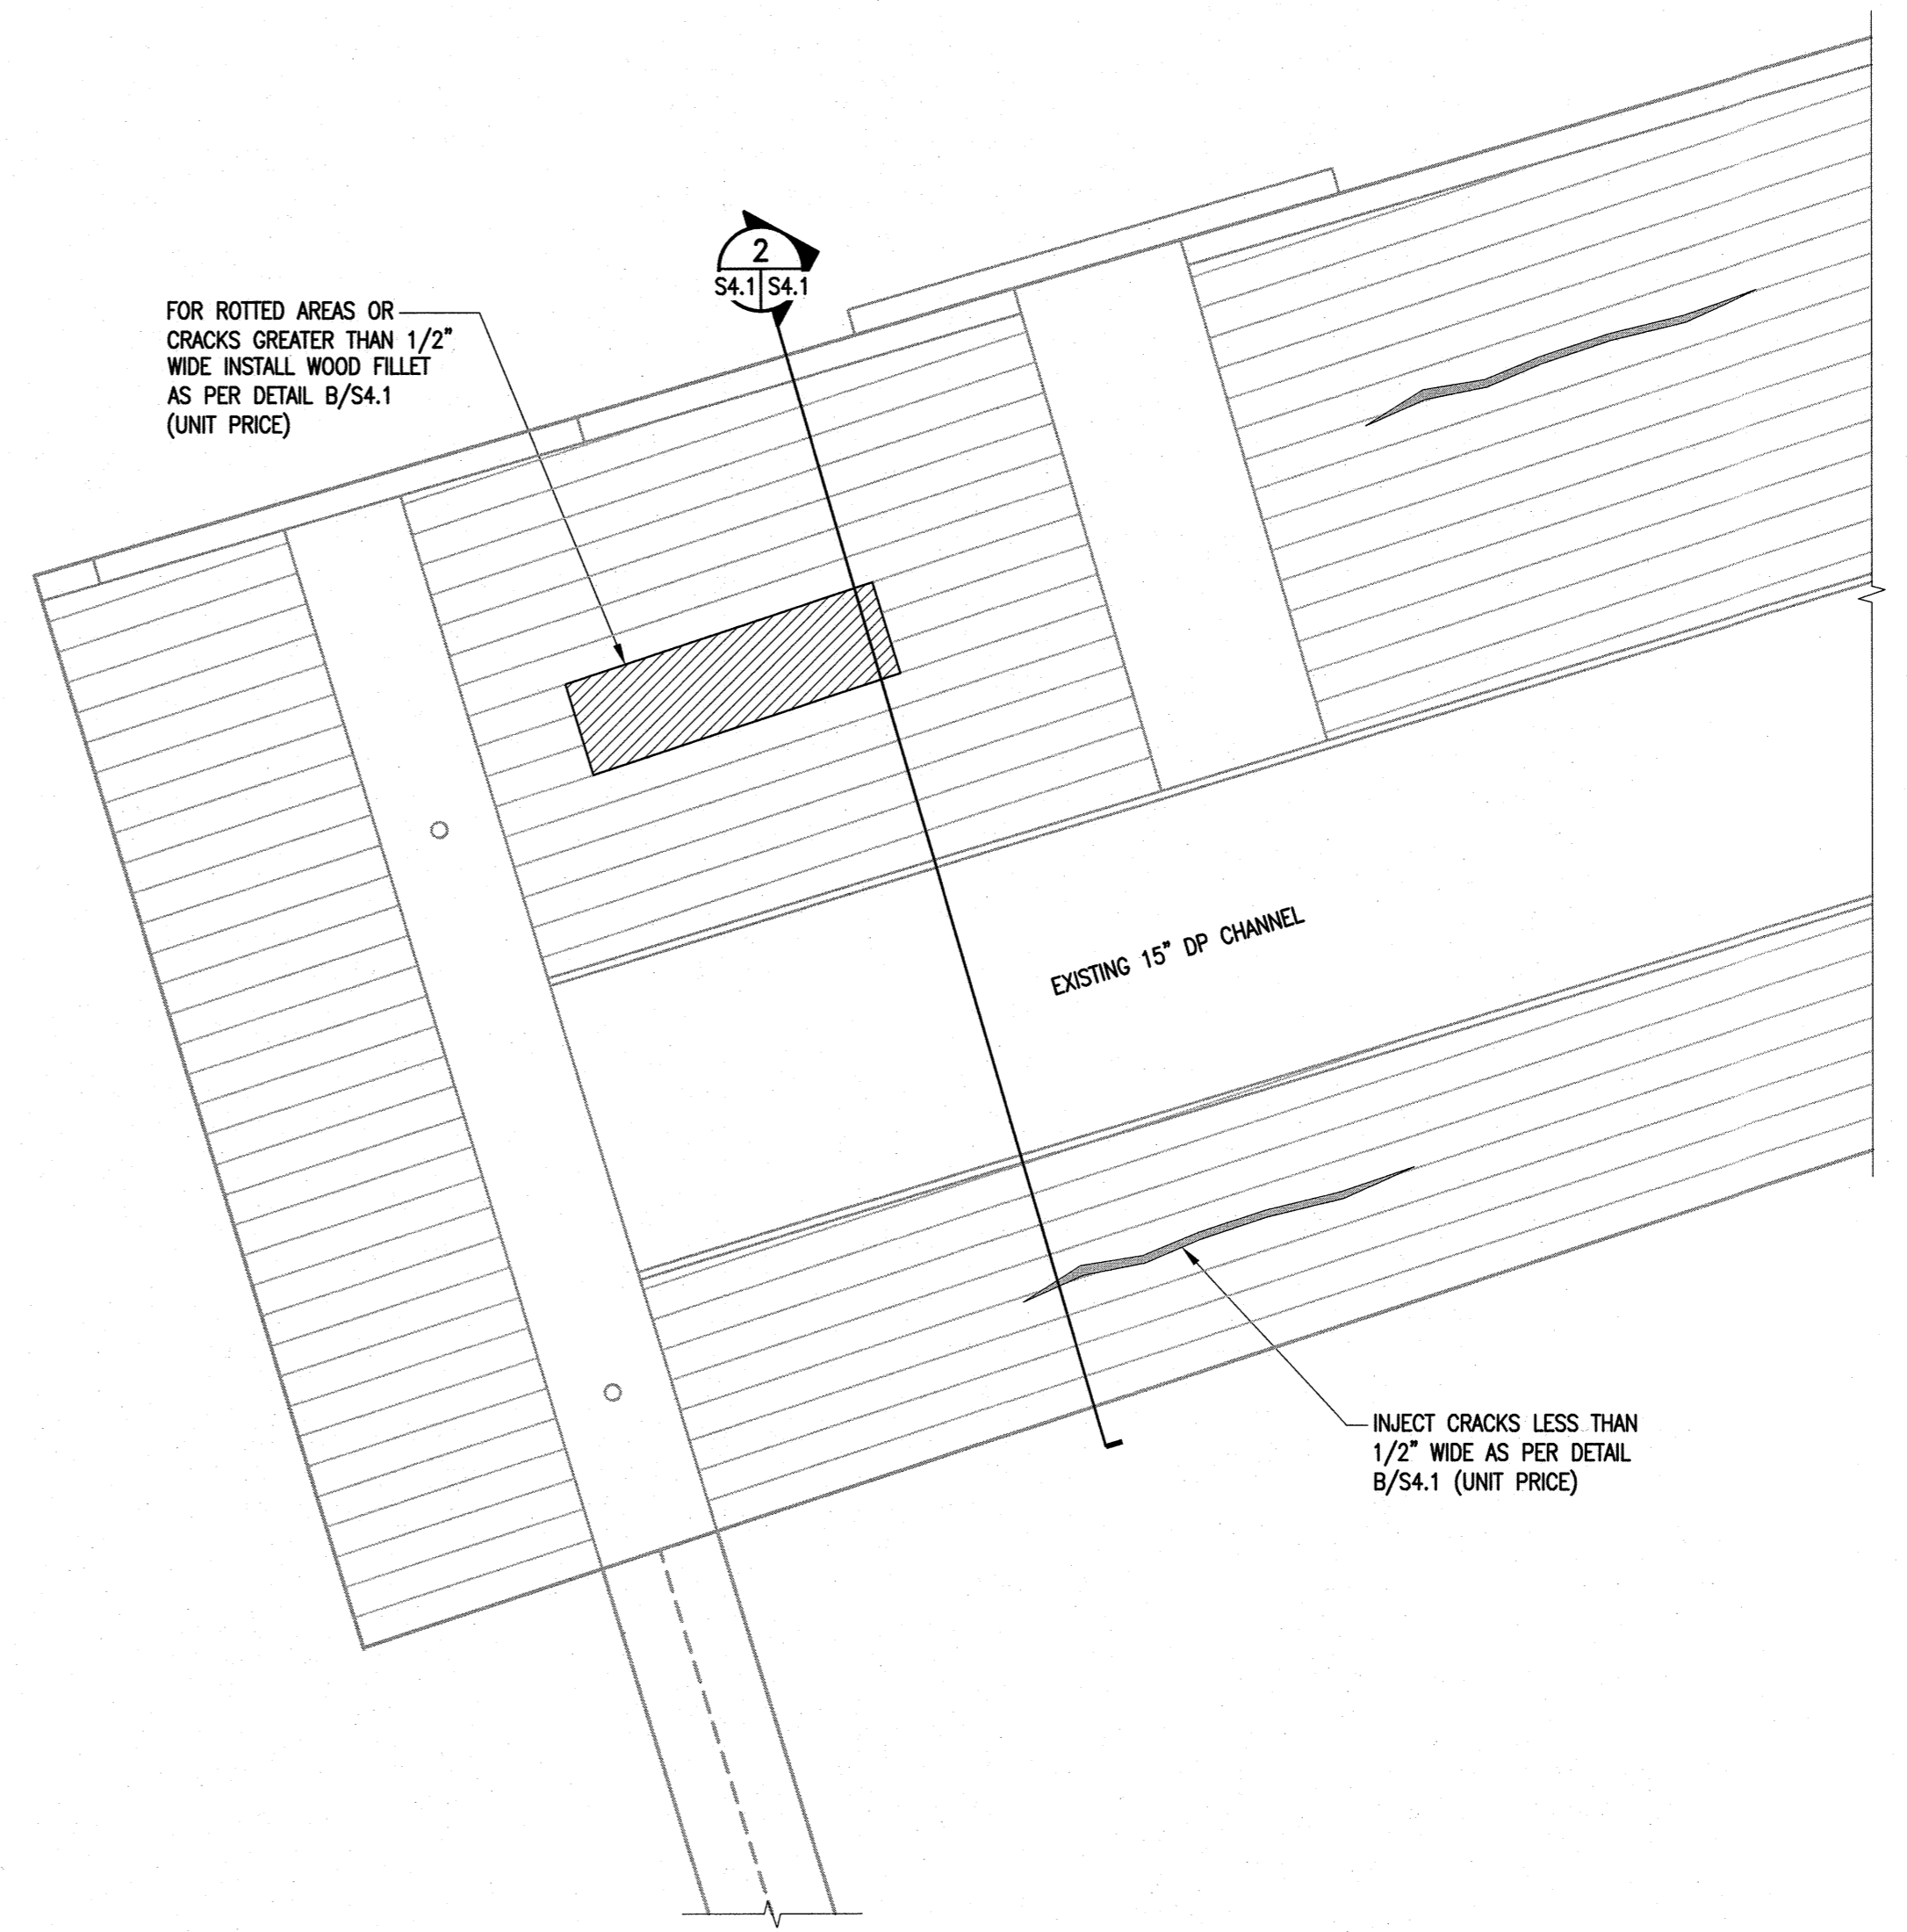

**A** PARTIAL GLULAM ELEVATION  
 S4.1 1-1/2" = 1'-0"

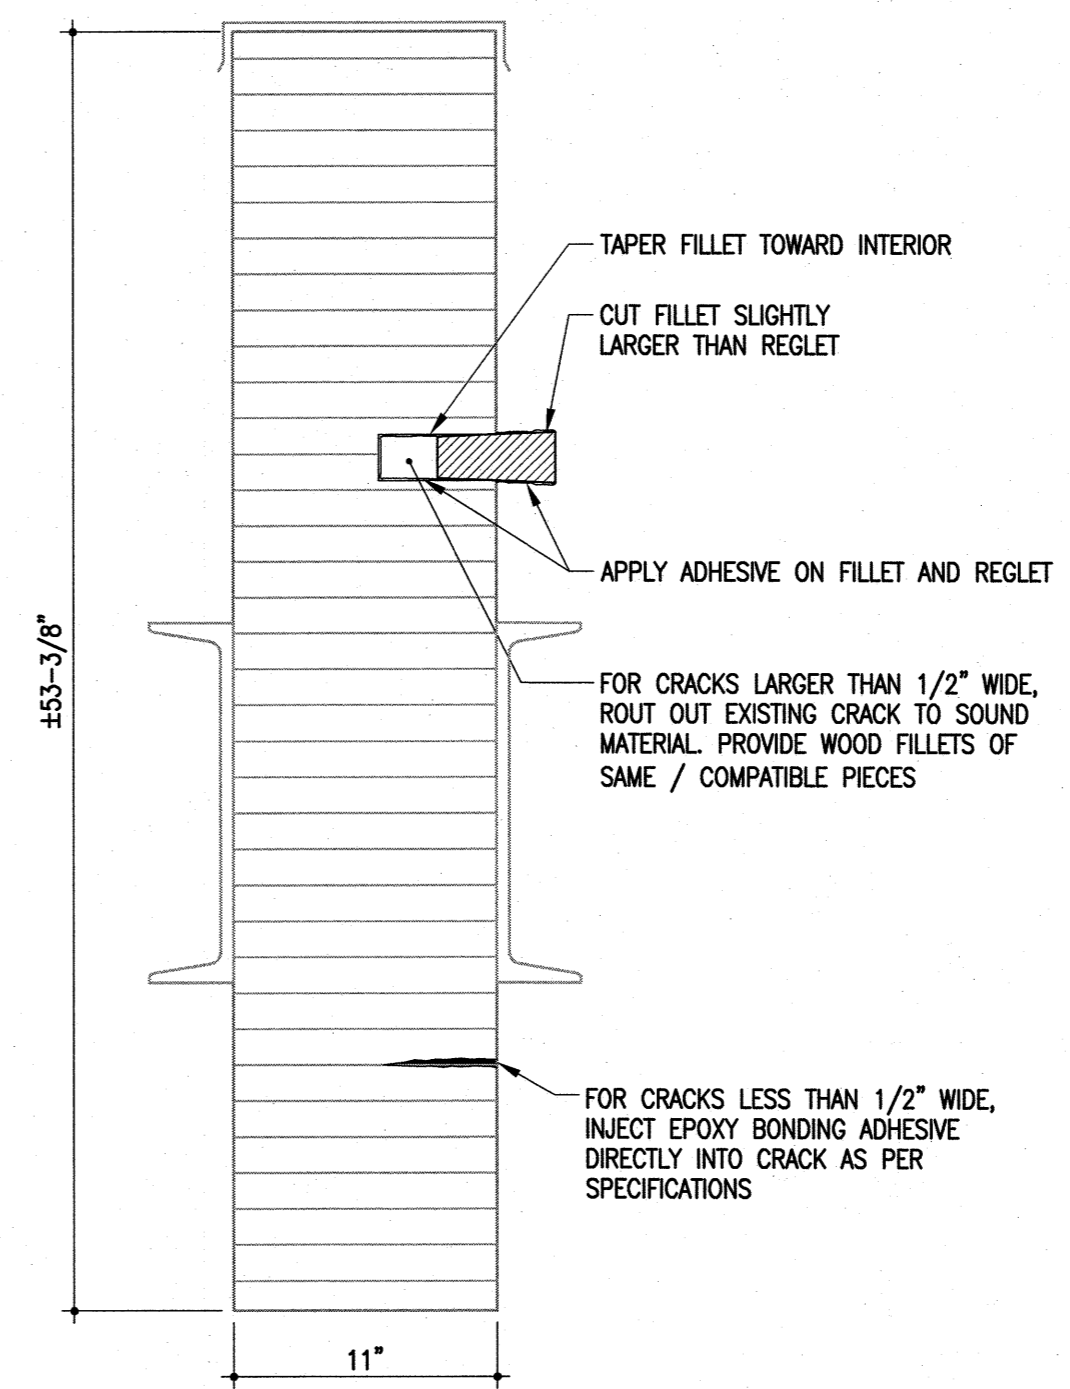

**B** GLULAM EPOXY INJECTION & WOOD FILLET REPAIR  
 S4.1 S4.1 1-1/2" = 1'-0"

The General Contractor shall check & verify all dimensions and report any errors or omissions to the designers.

0	2017-04-19	ISSUED FOR CONSTRUCTION	SMC
No.	Date	Issue/Revision	By

**APEGM**  
 Certificate of Authorization  
 Crosier Kilgour & Partners Ltd.  
 No. 235 Date: 2017-04-19

PROVINCE OF MANITOBA  
 S.M.A.  
**CABIGTING**  
 Member  
 24563  
 APR 15/17  
 REGISTERED PROFESSIONAL ENGINEER

Consultant

300-275 Carlton Street  
 Winnipeg, Manitoba R3C 5R6  
 T 204. 943. 7501  
 F 204. 943. 7507

**Crosier Kilgour & Partners Ltd.**  
 CONSULTING STRUCTURAL ENGINEERS

Project  
**CENTURY ARENA**  
 GLULAM REPAIRS  
 1377 CLARENCE AVENUE  
 WINNIPEG, MANITOBA

Sheet Title  
 GLULAM REPAIR SECTIONS & ELEVATIONS

File	2017-0007	Date	2017-04-19
Design	SMC	Drawn	RJM
Revision	Sheet No.		

**A** **S4.1**