


APPENDIX A
TEST HOLE LOGS


PROJECT: CSO Abatement and 290 Waterfront Drive	CLIENT: The City of Winnipeg, W&W Dept.	TESTHOLE NO: TH-05-01
LOCATION: South Side of Bannatyne, East of Rorie St.		PROJECT NO.: D265-177-00-07
CONTRACTOR: Paddock Drilling Ltd.	METHOD: 125 mm Solid Stem Augers	ELEVATION (m):
SAMPLE TYPE	<input checked="" type="checkbox"/> GRAB <input type="checkbox"/> SHELBY TUBE <input checked="" type="checkbox"/> SPLIT SPOON <input type="checkbox"/> BULK <input type="checkbox"/> NO RECOVERY <input type="checkbox"/> CORE	

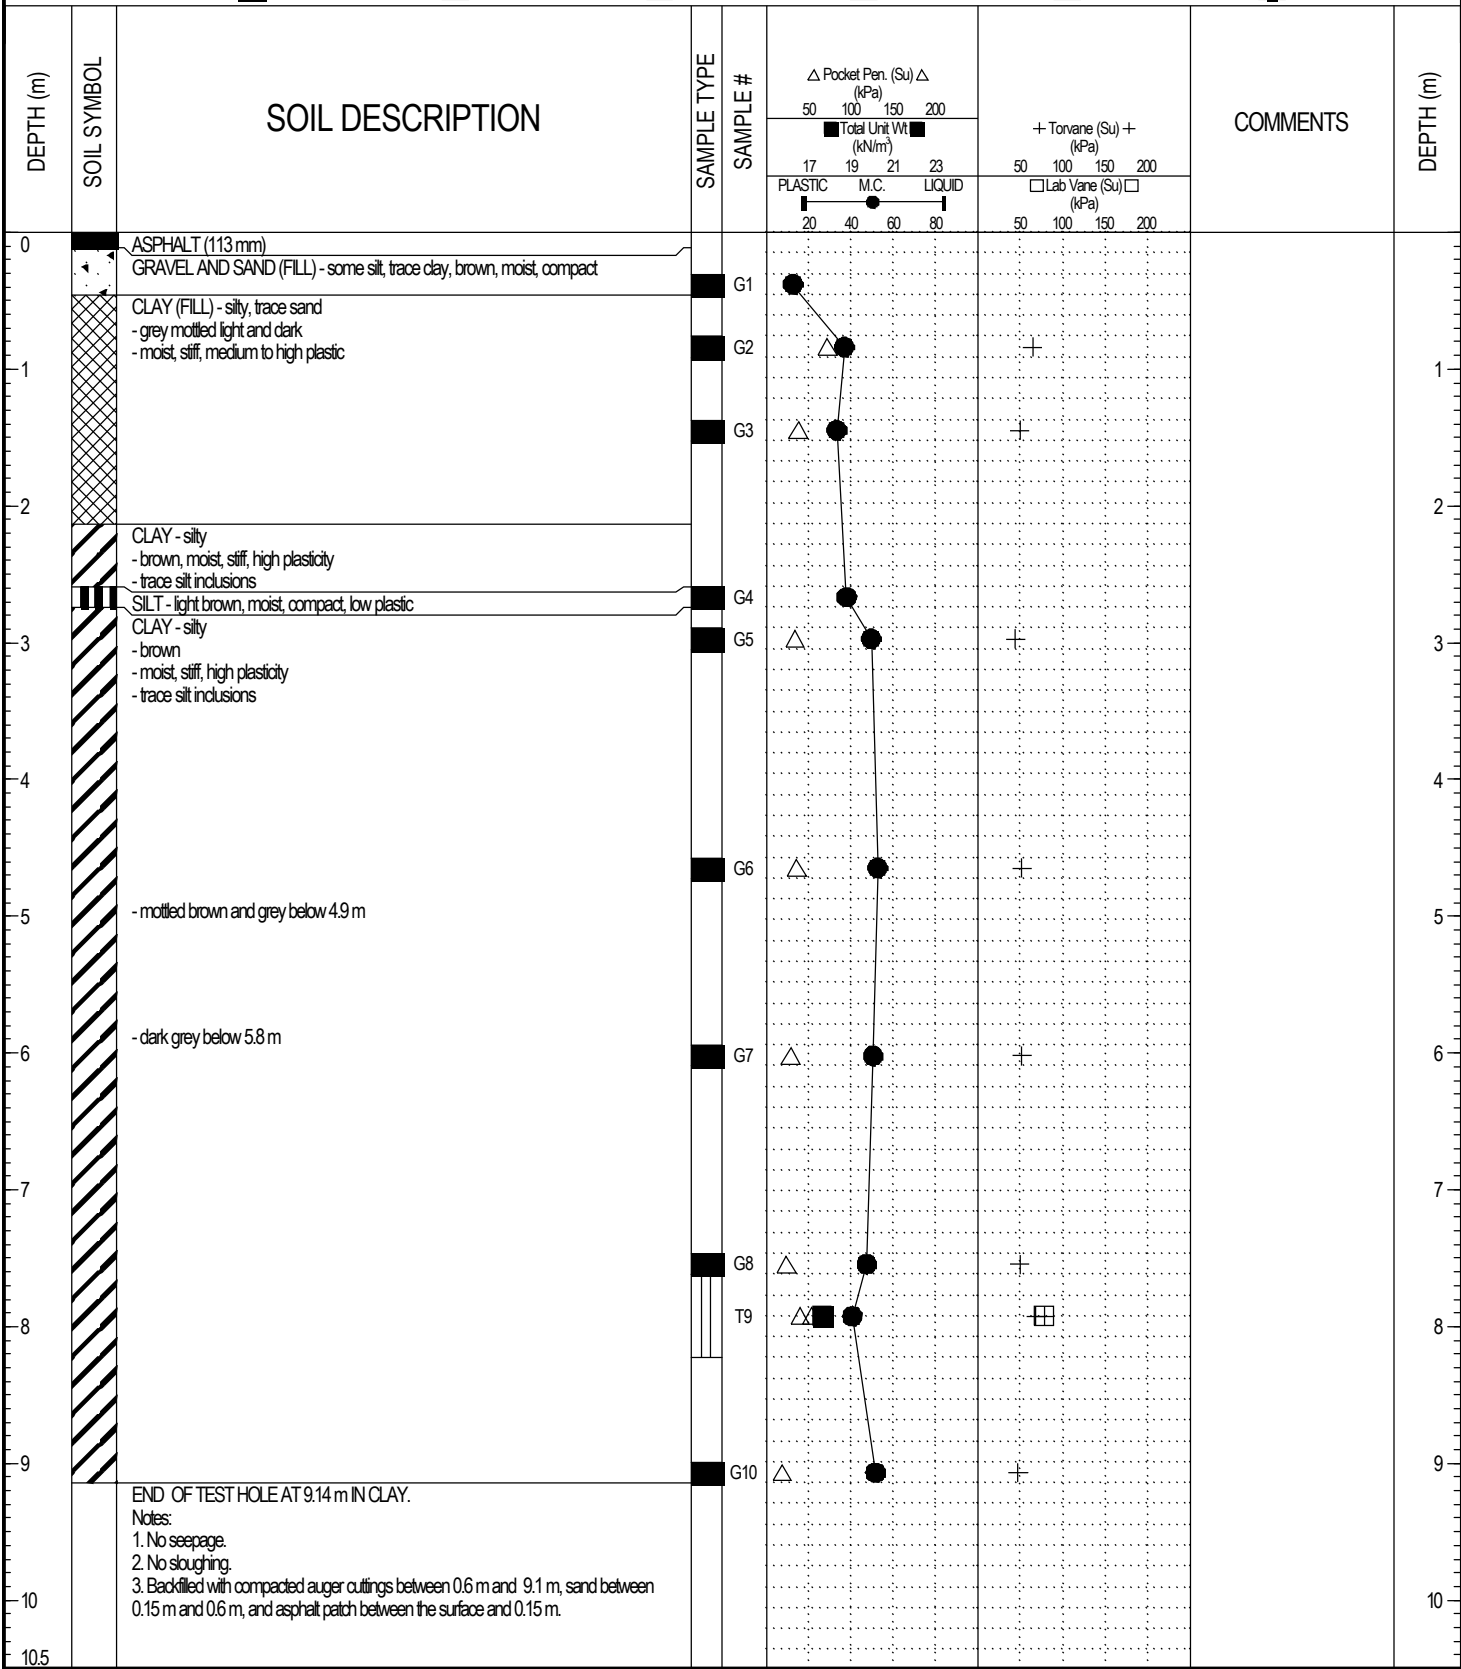

LOG OF TESTHOLE CSO ABATEMENT.GPJ UMA.GDT 9/8/05

END OF TEST HOLE AT 9.14 m IN CLAY.
Notes:
1. No seepage.
2. No sloughing.
3. Backfilled with compacted auger cuttings between 0.6 m and 9.1 m, sand between 0.15 m and 0.6 m, and asphalt patch between the surface and 0.15 m.


PROJECT: CSO Abatement and 290 Waterfront Drive	CLIENT: The City of Winnipeg, W&W Dept.	TESTHOLE NO: TH-05-02
LOCATION: South Side of Bannatyne, West of Ship St.		PROJECT NO.: D265-177-00-07
CONTRACTOR: Paddock Drilling Ltd.	METHOD: 125 mm Solid Stem Augers	ELEVATION (m):
SAMPLE TYPE	<input checked="" type="checkbox"/> GRAB <input type="checkbox"/> SHELBY TUBE <input checked="" type="checkbox"/> SPLIT SPOON <input type="checkbox"/> BULK <input type="checkbox"/> NO RECOVERY <input type="checkbox"/> CORE	

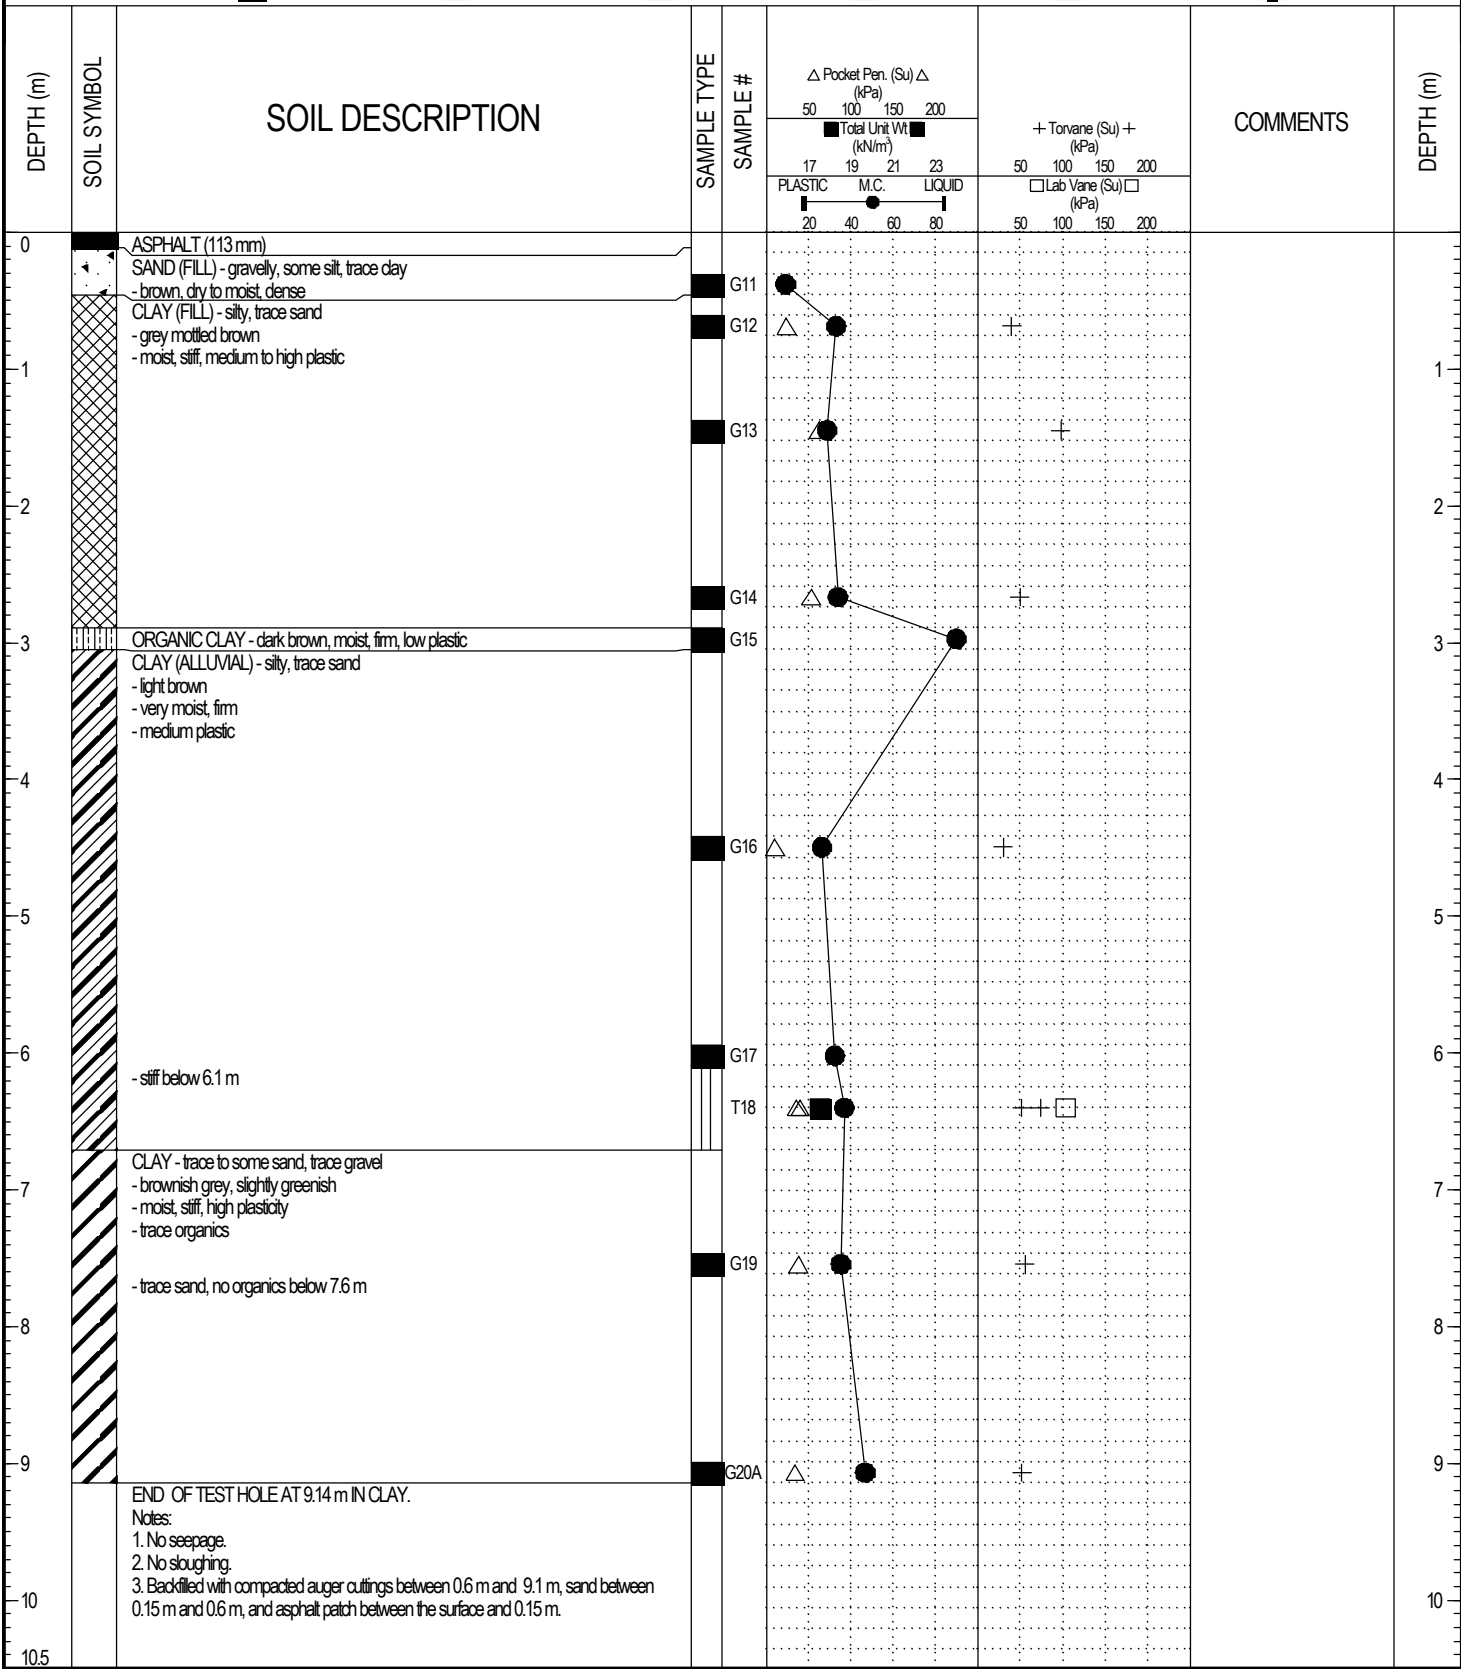

LOG OF TESTHOLE CSO ABATEMENT.GPJ UMA.GDT 9/8/05

- Notes:
1. No seepage.
 2. No sloughing.
 3. Backfilled with compacted auger cuttings between 0.6 m and 9.1 m, sand between 0.15 m and 0.6 m, and asphalt patch between the surface and 0.15 m.

PROJECT: CSO Abatement and 290 Waterfront Drive	CLIENT: The City of Winnipeg, W&W Dept.	TESTHOLE NO: TH-05-03
LOCATION: South Side of Bannatyne, East of Ship St.		PROJECT NO.: D265-177-00-07
CONTRACTOR: Paddock Drilling Ltd.	METHOD: 125 mm Solid Stem Augers	ELEVATION (m):
SAMPLE TYPE	<input checked="" type="checkbox"/> GRAB <input type="checkbox"/> SHELBY TUBE <input type="checkbox"/> SPLIT SPOON <input checked="" type="checkbox"/> BULK	<input checked="" type="checkbox"/> NO RECOVERY <input type="checkbox"/> CORE

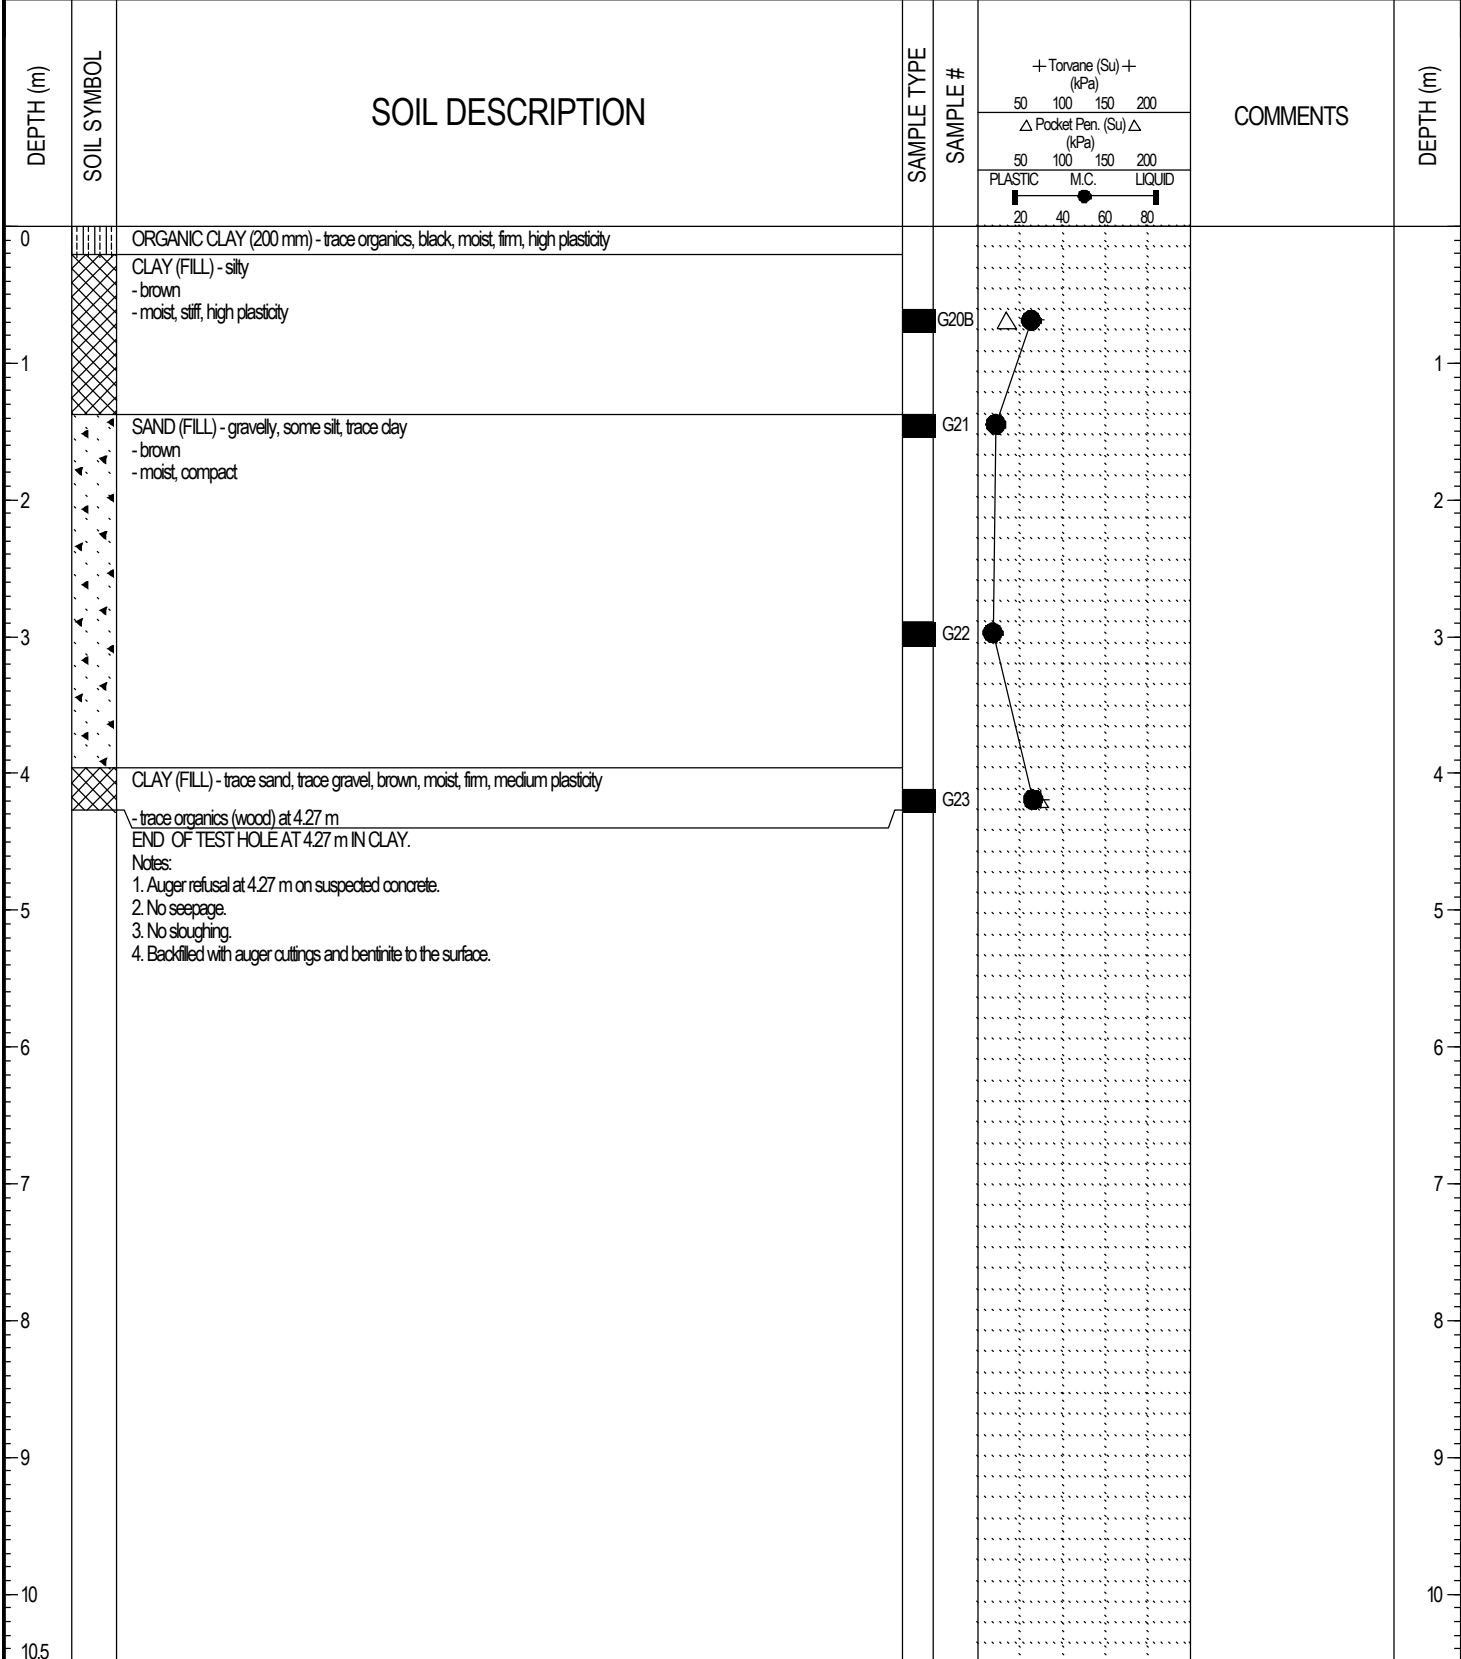

LOG OF TESTHOLE CSO ABATEMENT.GPJ UMA.GDT 9/8/05