




1 DETAIL AT CRACKS (< 1/16")
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

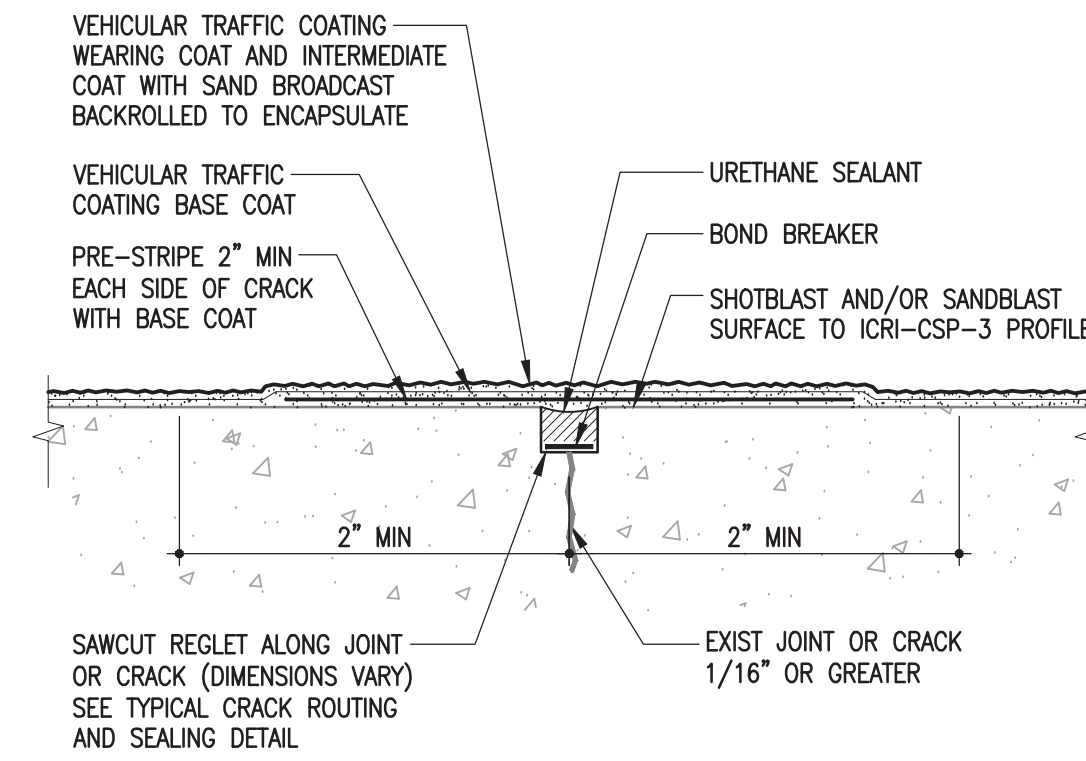


2 DETAIL AT JOINT OR CRACKS (1/16" OR GREATER)
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

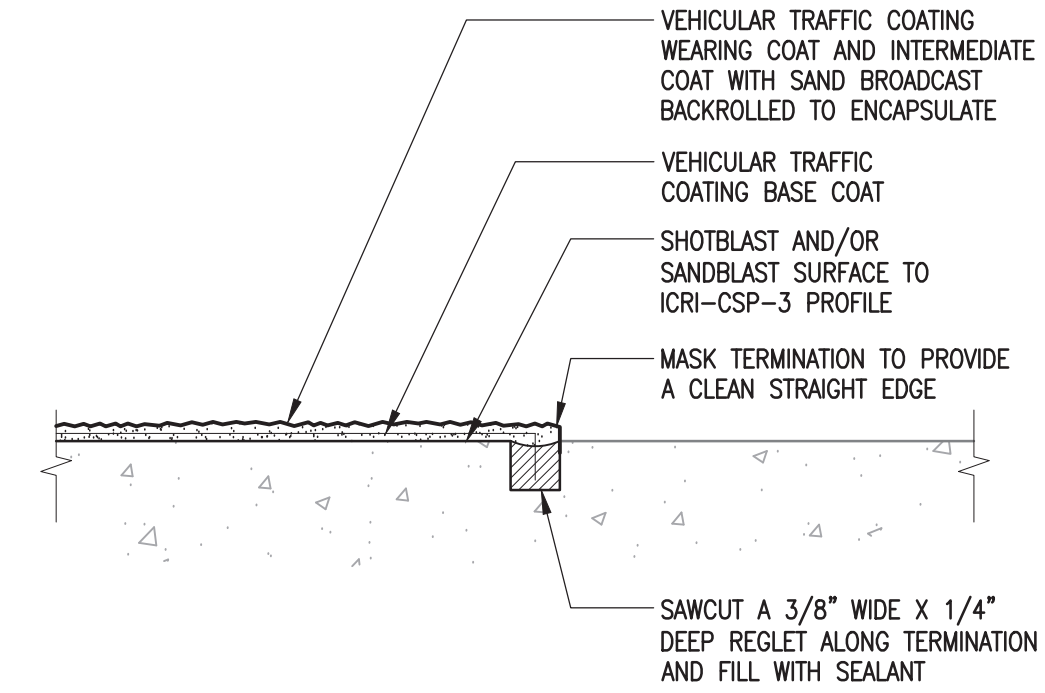


3 DETAIL AT HORIZONTAL TERMINATION
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

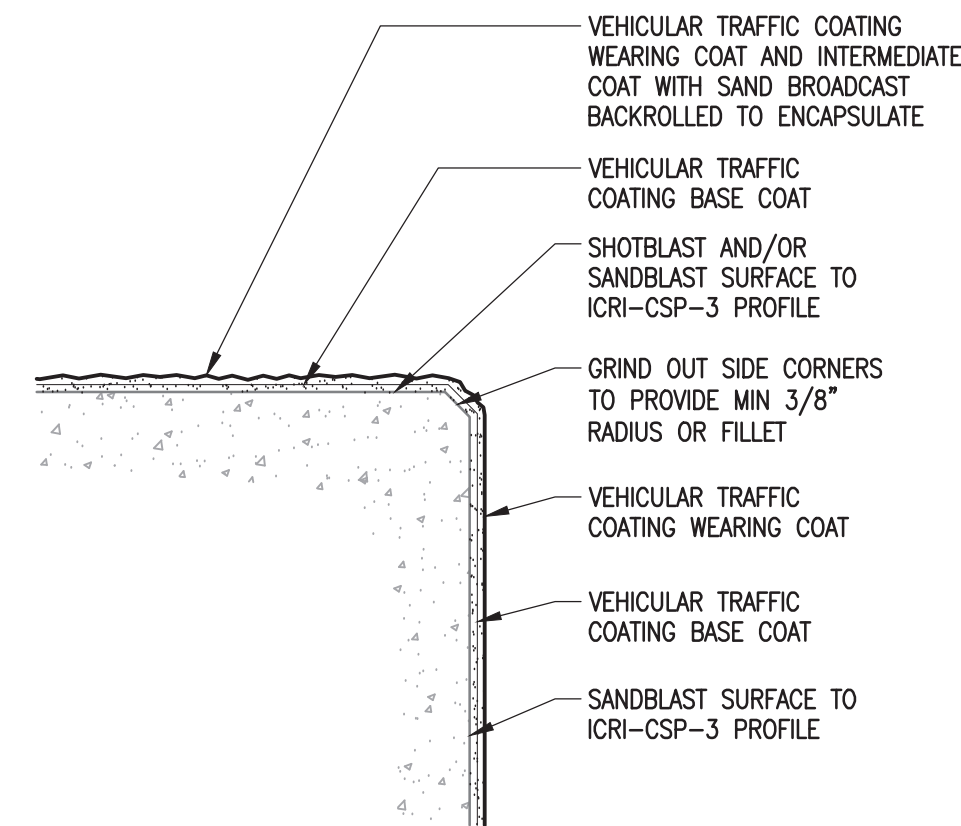


4 DETAIL AT OUTSIDE CORNER
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

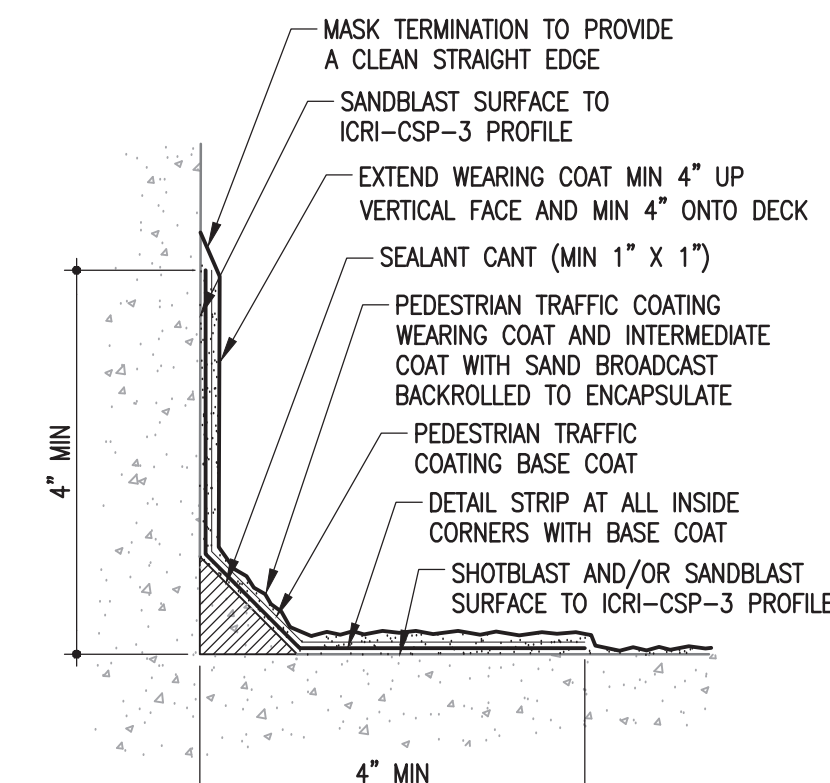

5 DETAIL AT INSIDE CORNER
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

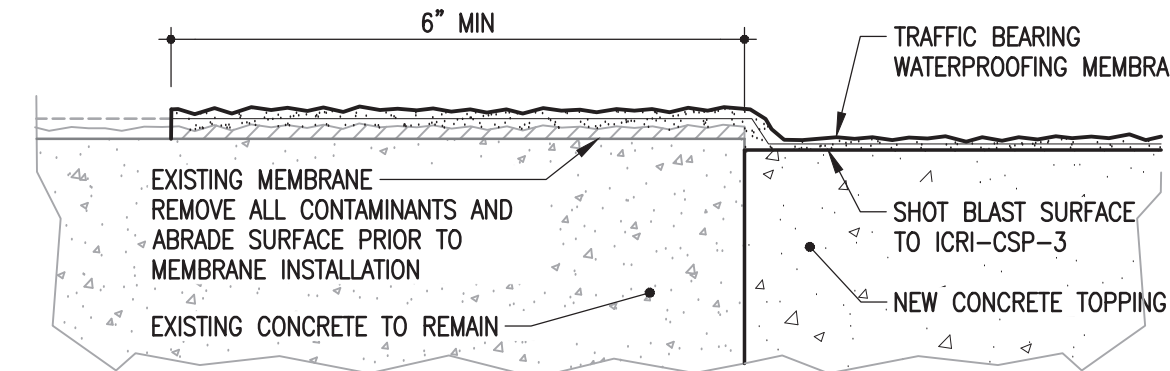

6 TYPICAL MEMBRANE REPAIR DETAIL
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

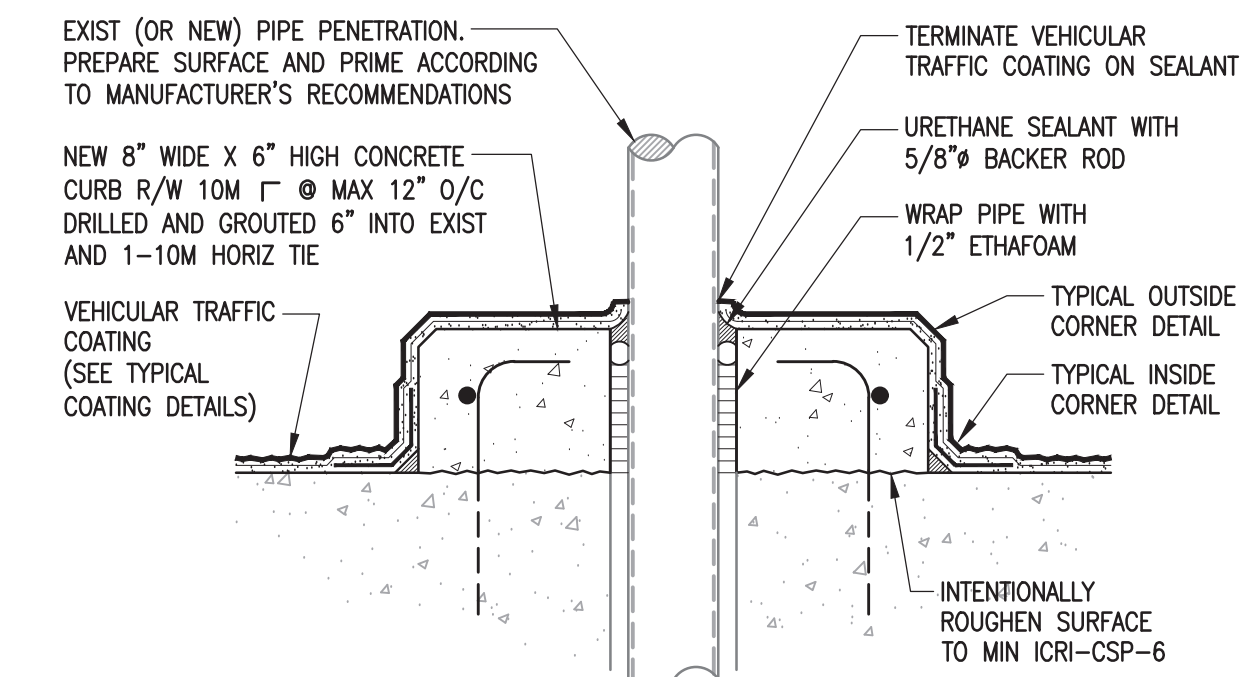

7 DETAIL AT PIPE PENETRATION
- S6.1 N.T.S. (VEHICULAR TRAFFIC COATING)

TYPICAL WATERPROOFING DETAILS – TRAFFIC BEARING MEMBRANE

The General Contractor shall check & verify all dimensions and report any errors or omissions to the designers.

0	2018-01-10	ISSUED FOR BID	PG
No.	Date	Issue/Revision	By

CONTRACT ADMINISTRATOR

390-275 Carlton Street
Winnipeg, Manitoba R3C 5R6
T 204-943-7501
F 204-943-7507



Crosier Kilgour & Partners Ltd.
CONSULTING STRUCTURAL ENGINEERS

Project
**FIRE PARAMEDIC SERVICE
STATION No. 5**
STRUCTURAL REPAIRS TO APPARATUS ROOM FLOORS
845 SARGENT AVENUE
WINNIPEG, MANITOBA

Sheet Title
**WATERPROOFING MEMBRANE
SECTIONS AND DETAILS**

File	2017-1192	Date	2017-12-22
Design	DJM/PG	Drawn	RBC

Revision	Sheet No.
0	S6.1